

Stants Capital Combustion,
203 Old Loudon Rd.
Latham, NY 12110



Date

6/15/2026

Invoice #

9085

Bill To

Town Of Colonie
534 Loudon Rd.
General Services Dept.
Newtonville, NY. 12128

P.O. No.	Terms	Due Date	Service Date
	Net 30	7/15/2026	6/12/2026

Item	Description	Qty	Rate	Amount
	Indoor Weather and they met us on site. Unit going off on high head. Adjusted charge in both circuits. Removed and cleaned fresh air screens and exhaust. We were able to get circuit 2 dialed in and working properly. However, when system dampers closed off, compressor started to short cycle. Need to return to further diagnose. 6/12/26 - Found fan cycle control to be failed and in need of replacement. 26050485 08-6E-E63-7410-443 Bid Date 10/22/24 (2) 6/30/26			

Phone # 518-785-8539
Fax 518-785-4319

Subtotal	\$11,450.00
Sales Tax (0.0%)	\$0.00
Total	\$11,450.00
Balance Due	\$11,450.00

Stants Capital Combustion,

203 Old Loudon Rd.

Latham, NY 12110



Date

6/15/2026

Invoice #

9085

Bill To

Town Of Colonie
534 Loudon Rd.
General Services Dept.
Newtonville, NY. 12128

P.O. No.

Terms

Due Date

Service Date

Net 30

7/15/2026

6/12/2026

Item	Description	Qty	Rate	Amount
Service	Service Call - William K. Sanford Town Library - Air handler not kicking on 5/28/26 - Found RTU to be in a compressor alarm. Verified electrical components and put gauges on system. Found that both circuits were low on charge. There was pressure on system so leak checked with ultrasonic leak detector. Found that multiple Schrader fittings were leaking. Replaced Schrader cores and caps. Need to return to recharge and start up. 5/29/26 - Charged circuits to proper refrigerant charge. Found that when circuit 1 started, a service fitting braze joint that was installed on a previous compressor install cracked. Recovered refrigerant from circuit, will return to repair and recharge. 6/02/26 - Made repairs to circuit 1. While brazing service port, found that when replacement compressor was installed, fittings were soldered. Had to repair solder joints on compressor discharge as the brazing procedure was hotter than soldering and solder came out of fittings. Once repairs were completed, performed standing pressure test and leak check. Started the evacuation procedure of circuit 1. 6/03/26 - Struggled with getting units started. Met with	1	11,450.00	11,450.00

Subtotal

Sales Tax (0.0%)

Total

Balance Due